



## Technical Information

# Machining Accuracy of Machine Tools

Productivity and accuracy of machine tools are important competition aspects. Rapidly changing operating conditions for machine tools, however, make it difficult to increase productivity and accuracy. In the manufacture of parts, increasingly small batch sizes have to be produced economically, and yet accurately. In the aerospace industry, maximum cutting capacity is needed for the roughing processes, whereas the subsequent finishing processes must be executed with maximum precision. For milling high-quality molds, high material removal rates are required during roughing and excellent surface quality must be obtained after finishing. At the same time, maximum contouring feed rates are necessary to realize the required minimum distances between the paths within acceptable machining times.

Thermal accuracy of machine tools is becoming increasingly important considering the strongly varying operating conditions in manufacturing. Especially with small production batches that require constantly changing machining tasks, a thermally stable condition cannot be reached. At the same time, the accuracy of the first workpiece is becoming very important for the profitability of production orders. Constant changes between drilling, roughing and finishing operations contribute to the fluctuations in the thermal condition of a machine tool. During the roughing operations, the milling rates increase to values above 80%, whereas values below 10% are reached during finishing operations. The increasingly high accelerations and feed rates cause heating of the recirculating ball screw in linear feed drives. Position measurement in the feed drives therefore plays a central role in stabilizing the thermal behavior of machine tools.

### Thermal stability of machine tools

Solutions for avoiding thermally induced dimensional deviations of workpieces have become more crucial than ever for the machine tool building industry. Active cooling, symmetrically designed machine structures and temperature measurements are already common practice.

Thermal drift is primarily caused by feed axes on the basis of recirculating ball screws. The temperature distribution along the ball screw can rapidly change as a result of the feed rates and the moving forces. On machine tools without linear encoders, the resulting changes in length (typically: 100  $\mu\text{m}/\text{m}$  within 20 min.) can cause significant flaws in the workpiece.

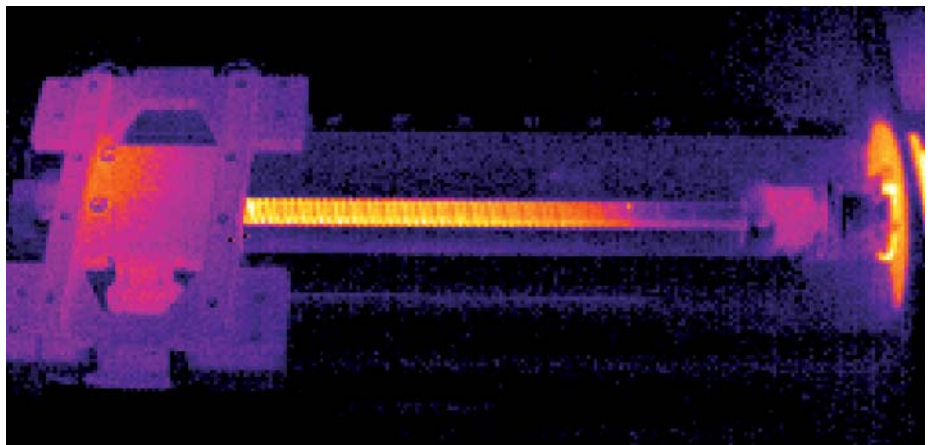




Figure 1 Heating of a recirculating ball screw during multipass milling at a mean feed rate of 10 m/min. This thermographic snapshot shows temperatures of 25 °C  to 40 °C .

## Position Measurement on Feed Drives

The position of an NC feed axis can be measured in principle through the ball screw in combination with a rotary encoder, or through a linear encoder.

If the slide position is determined from the pitch of the feed screw and a rotary encoder (Figure 2, top), then the ball screw must perform two tasks: As the drive system it must transfer large forces, but as the measuring device it is expected to provide highly accurate values and to reproduce the screw pitch. However, the position control loop only includes the rotary encoder.

Because changes in the driving mechanics due to wear or temperature cannot be compensated, this is called semiclosed-loop operation. Positioning errors of the drives become unavoidable and can have a considerable influence on the quality of workpieces.

If a linear encoder is used for measurement of the slide position (Figure 2, bottom), the position control loop includes the complete feed mechanics. This is therefore referred to as closed-loop operation. Play and inaccuracies in the transfer elements of the machine have no influence on the accuracy of the position measurement. Measurement accuracy depends almost solely on the precision and installation location of the linear encoder.

This basic consideration applies both for linear axes and rotary axes, where the position can be measured with a speed-reduction mechanism connected to a rotary encoder on the motor, or with a highly accurate angle encoder on the machine axis. Significantly higher accuracy grades and reproducibility are achieved if angle encoders are used.

### Additional measures for semiclosed-loop operation

In order to prevent heating of the ball screw and the surrounding parts of the machine, some ball screws feature hollow cores for coolant circulation. In semiclosed-loop operation the positioning accuracy is affected by thermal expansion of the ball screw and thus depends on the temperature of the coolant. A temperature increase of only 1 K results in positioning errors up to 10  $\mu\text{m}$  over a traverse range of 1 m. Common cooling systems, however, are often unable to restrict the temperature variations to values significantly below 1 K.

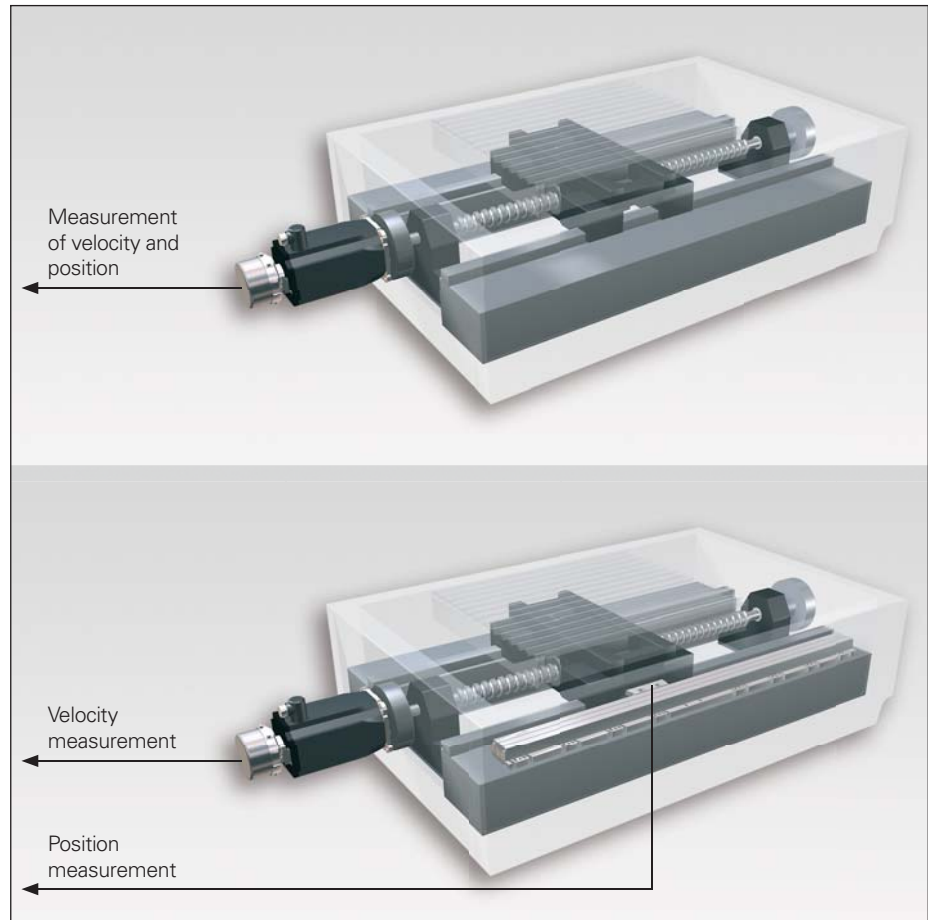


Figure 2 Position feedback control in semiclosed-loop mode (top) and in closed-loop mode (bottom)

For drives in semiclosed-loop operation, thermal expansion of the ball screw is occasionally approximated using a model in the control. Because the temperature profile is difficult to measure during operation and is influenced by numerous factors – such as the wear of the recirculating ball nut, the feed rate, the cutting forces, the traverse range used, etc. – considerable residual errors up to 50  $\mu\text{m}/\text{m}$  can occur when this method is used.

The ball screw is sometimes provided with fixed bearings at both ends in order to increase the rigidity of the drive mechanics. But even very rigidly designed bearings cannot prevent expansion caused by local heat generation. The resulting forces are considerable. They deform the most rigid bearing configurations and can even cause

structural distortions in the machine geometry. Mechanical tension also changes the friction behavior of the drive, thus adversely affecting the contouring accuracy of the machine.

Due to these restrictions, the drive accuracy that can be attained by taking the described additional measures cannot be compared with closed-loop operation using linear encoders. Also, the additional measures for semiclosed-loop operation cannot compensate the effects of changes in the bearing preload due to wear, or elastic deformations of the drive mechanics.

## Effect of Drive Accuracy on the Manufacture of Parts

In the machine building industry the demand for small parts manufactured in small production runs is increasing considerably. The accuracy of the first workpiece is therefore becoming an important factor for the profitability of manufacturing companies. Machine tools for high-accuracy production of small batches are facing a real challenge. Constant changes between setting up the workpiece, drilling, roughing and finishing cause constant changes in the thermal condition of a machine.

The typical feed rates for roughing a workpiece range from 3 m/min to 4 m/min, whereas feed rates from 0.5 m/min to 1 m/min are used for finishing. Rapid traverse movements during tool exchange also considerably increase the average velocities. The medium feed rates during drilling and reaming are negligible for heat generation in recirculating ball screws. Due to the strongly varying feed rates, the temperature distribution along the ball screws changes during the individual process steps. In semiclosed-loop operation the varying loads on the recirculating ball screw may cause the workpiece accuracy to suffer, even if the workpieces are completely machined in just one setup. Machine tools with linear encoders in closed-loop mode are therefore absolutely necessary for high-accuracy production of small parts.

### Example of machining several parts from one blank form

An aluminum blank with a length of 500 mm is first drilled and then reamed on a machine tool. The medium feed rates during the two machining operations are low, so the heat generation in the recirculating ball screws is negligible. In the next production step the contour is milled and the medium feed rate increases significantly, resulting in considerable heat generation in the ball screws (Figure 3).

If the milling machine is operated in semiclosed-loop mode, thermal expansion of the recirculating ball screws causes deviations between the drilling pattern and the milling pattern. The maximum deviations of 135  $\mu\text{m}$  were measured near the loose bearings of the ball screw. In closed-loop operation these errors can be completely avoided (Figure 4).

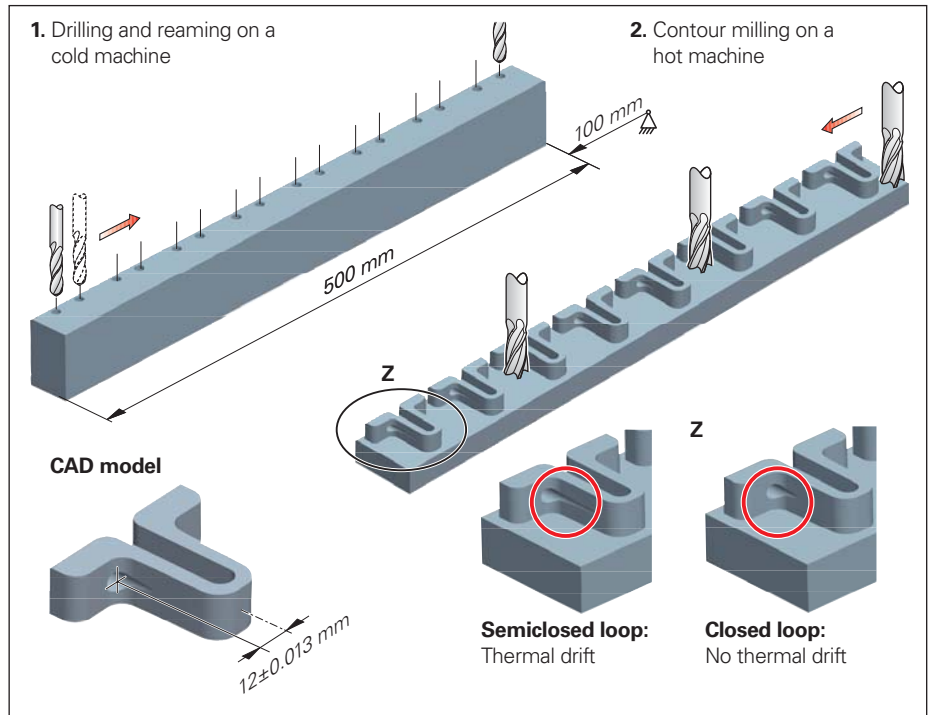


Figure 3 Effect of drive accuracy on the production of small parts  
 $\triangle$  = Fixed bearing of the recirculating ball screw

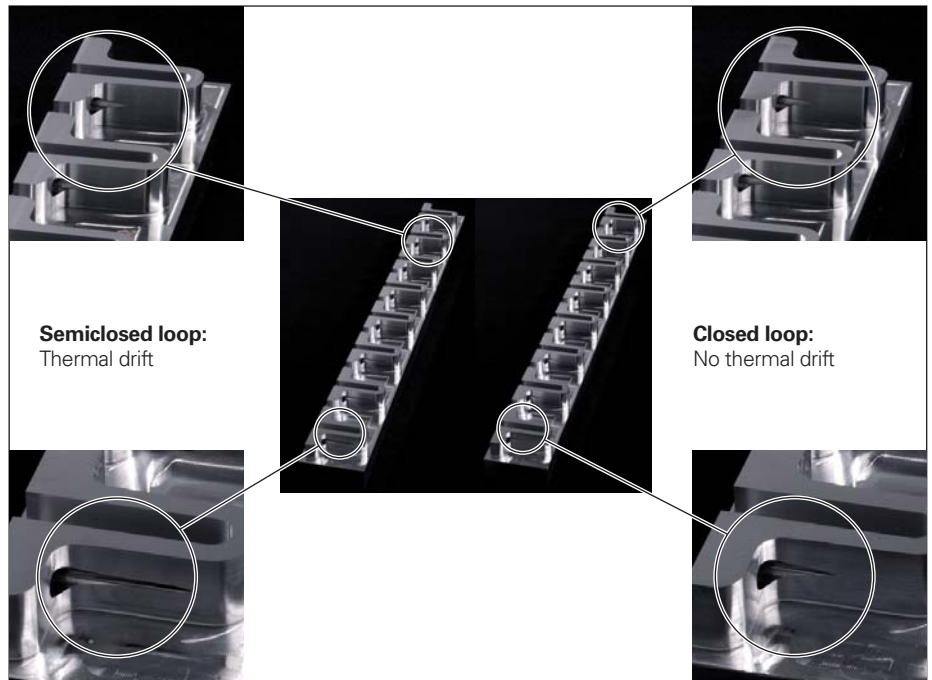


Figure 4 Effect of drive accuracy on the series production of small parts

The functional dimension between the position of the hole and the bisecting line of the individual workpiece is 12 mm and must meet tolerance grade IT8 in the illustrated example. This results in a permissible deviation of  $\pm 13 \mu\text{m}$ . All of the workpieces machined in closed-loop mode

are significantly within this tolerance. Deviations up to 135  $\mu\text{m}$  were measured in semiclosed-loop mode. Thus the workpiece only complies with tolerance grade IT13 instead of meeting the required tolerance grade IT8.

## Integral Components with High Degree of Stock Removal for the Aerospace Industry

Using integral components in the aerospace industry provides the benefit of combining optimum utilization of the material characteristics with minimum weight. Typical integral components feature a degree of stock removal of 95% and more. Today high-performance HSC machine tools in conjunction with high feed rates and high cutting speeds are used in the manufacturing processes. The high material removal rates made possible by the remarkable degree of stock removal of the components are of great economic significance. But the resulting feed rates and machining forces also generate considerable frictional heat in the recirculating ball screws. Also, friction losses and the resulting thermal expansion of the ball screws vary during a machining process, for example because of different feed rates during roughing and finishing. If the feed drives are operated in semiclosed-loop mode (without linear encoders), part dimensions differ for each single component manufactured in small production runs with short cycle times. Due to thermal expansion, the specified manufacturing tolerances might not be achieved. Such sources of errors can be prevented through the use of linear encoders, since thermal expansion of the ball screws is then fully compensated for in closed-loop operation.

### Example of machining a coupling lever for an aerofoil

Figure 5 describes the manufacturing of a coupling lever, requiring the machining of two holes at distance of 350 mm from each other with a tolerance grade of IT7. The integral component is manufactured twice from the same blank form to permit evaluation of the accuracy that can be achieved in semiclosed-loop mode. The second workpiece is simply machined 10 mm below the first. Between the two machining operations, twenty machining cycles for the same part are executed above the blank.

In semiclosed-loop operation, the contour of the second workpiece deviates from the contour of the first workpiece, as is shown by an edge (Figure 6). The farther the drives move away from the fixed bearings of the recirculating ball screw during machining, the more obvious the thermal expansion of the ball screw becomes.

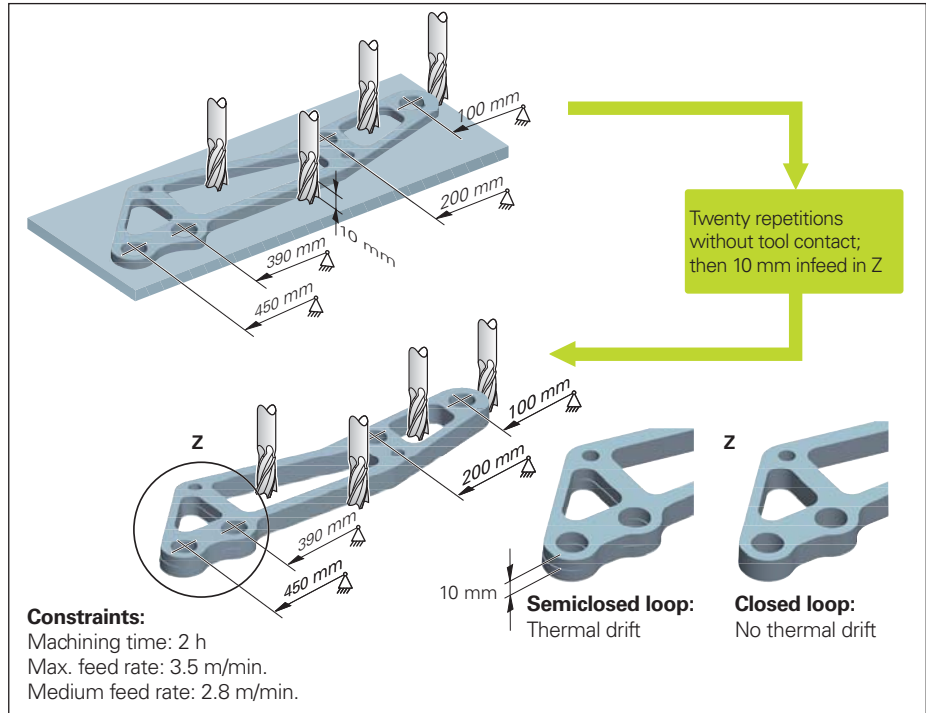


Figure 5 Manufacturing of the coupling lever  
 = Fixed bearing of the recirculating ball screw



Figure 6 Coupling lever, processed twice from one blank form

The required functional dimension of 350 mm with a tolerance grade of IT7 corresponds to a permissible deviation of  $\pm 28 \mu\text{m}$ . The second workpiece machined in semiclosed-loop mode is unable to meet this requirement. The deviation is  $44 \mu\text{m}$ . With the use of linear encoders in closed-loop mode in this test, no edge results.

The residual deviations of  $10 \mu\text{m}$  that occur in closed-loop operation are due to thermally induced, structural distortions of the machine geometry. The specified dimensions for the two bore holes can even be improved to IT5. A reproducible accuracy from the very first part is thus guaranteed.

## Effects on Mold and Die Making

The manufacturing of molds or dies for injection-molded or die-cast components is a time-consuming task because it requires superior surface finish for sometimes very fine structures. Today many molds are directly milled in order to avoid the cost and time consuming eroding process. Increasingly small milling cutters with diameters as small as 0.12 mm are used. Mold and die making for milling is characterized not only by high demands upon dimensional accuracy. It also requires high feed rates, including for hardened materials, to reduce the machining times. Typical machining times for molds and dies range from 10 minutes to several days. Dimensional accuracy, however, must not be sacrificed to fast execution. The first and last machining paths must be identical in order to ensure that the time previously gained is not lost to complex rework.

The heating of the recirculating ball screws in the feed axes substantially depends on the velocity profile specified for the individual axes by the NC program, and can cause changes in length up to 150  $\mu\text{m}/\text{m}$  in the recirculating ball screws. These conditions make it impossible to guarantee dimensional accuracy in semiclosed-loop operation. Typical heating of the recirculating ball screw would cause an edge deviation of more than 20  $\mu\text{m}$  in a mold with a length of only 150 mm. The expansion of the recirculating ball screw would result in so large a half of a die that the flaw can no longer be corrected by rework.

### Example of 3-D milling of freeform surfaces

The following example illustrates the machining of a mold with the classic profile of the Watzmann – a legendary mountain in the German Alps. A 500-mm long workpiece is machined with multipass, climb and upcut milling cycles in the X direction, using a ball-nose cutter with a diameter of 12 mm and a maximum feed rate of 4.5 m/min. It takes around 60 minutes to machine the contour with an infeed of 0.2 mm in the Z and Y directions. The high feed rate of 4.5 m/min together with the constant accelerations and decelerations generate heat in the recirculating ball screw and cause thermally

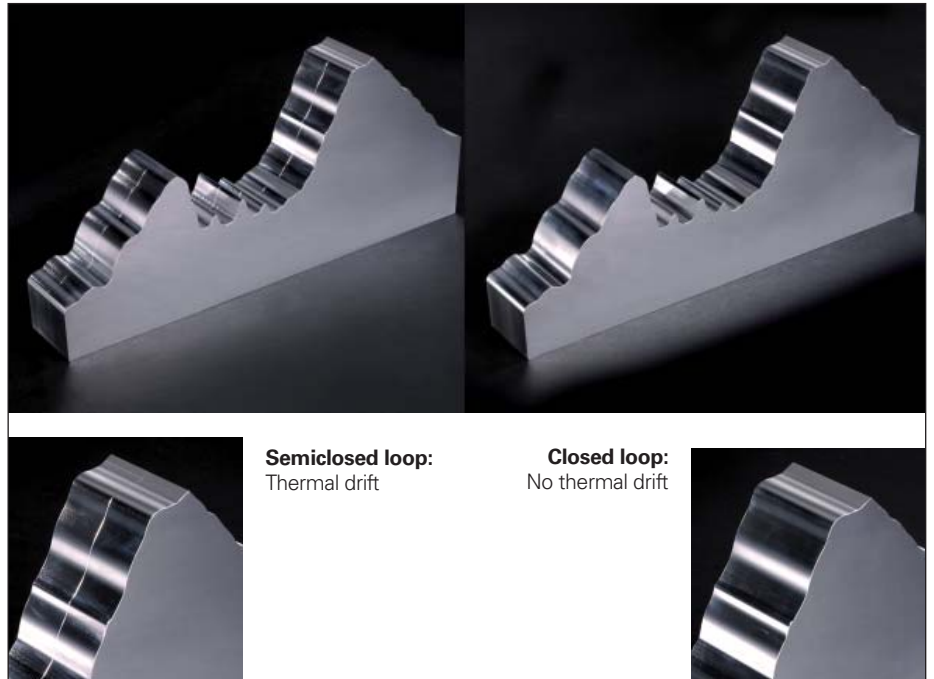


Figure 7 Watzmann profile with free-formed surfaces

induced linear deviations of 130  $\mu\text{m}$  in semiclosed-loop operation. Because the linear deviation with this mold component is difficult to visualize, machining was deliberately begun in the middle of the workpiece. Start and end paths therefore lie side by side and clearly show the thermal drift. The farther the workpiece position is away from the fixed bearing, the higher the thermal drift is.

In order to fulfill the high requirements of mold and die making, it is necessary to compensate the expansion of ball screws by using accurate linear encoders. In Figure 7 the high-accuracy workpiece with an excellent surface finish manufactured in closed-loop mode is compared with a workpiece manufactured in semiclosed-loop mode.

### Summary

The successful fulfillment of manufacturing orders requires machine tools with high thermal stability. Machine accuracy must be maintained even under strongly varying load conditions. As a consequence, feed axes must achieve the required accuracy over the complete traverse range even

with strongly varying speeds and machining forces. Thermal expansion in the recirculating ball screws of the linear feed axes adversely affects accuracy and varies depending on the velocity and load. Position errors of 100  $\mu\text{m}$  and more may result within 20 minutes during a machining operation if the slide position is only determined from the spindle pitch and a rotary encoder. Because essential drive errors are not compensated in the control loop when this method is used, this is referred to as semiclosed-loop operation of the feed drive. These errors can be completely eliminated by using linear encoders. Feed drives with linear encoders are operated in closed-loop mode because errors in the recirculating ball screw are considered in position measurement and compensated in the position control loop. Angle encoders used on rotary axes provide similar benefits since the mechanical drive components are also subject to thermal expansion. Linear and angle encoders therefore ensure high precision of the components to be manufactured even under strongly varying operating conditions of the machine tools.

# Linear Encoders for Machine Tools

Linear encoders for position feedback are indispensable for high positioning accuracy of machine tools. They directly capture the actual position of the feed axis. Mechanical transfer elements therefore have no influence on position measurement – both kinematics errors and deviations due to thermal influences or other forces are measured by the linear encoder and considered in the position control loop. This can eliminate a number of potential error sources:

- Positioning error due to thermal behavior of the recirculating ball screw
- Reversal error
- Errors due to deformation of the drive mechanics by machining forces
- Kinematics error through ball-screw pitch error

Linear encoders are therefore indispensable for machines that must fulfill high requirements for **positioning accuracy** and **machining speed**.

Linear encoders from HEIDENHAIN for numerically controlled machine tools can be used nearly everywhere. They are ideal for machines and other equipment whose feed axes are in a closed loop, such as milling machines, machining centers, boring machines, lathes and grinding machines.

The beneficial dynamic behavior of the linear encoders, their highly reliable traversing speed, and their acceleration in the direction of measurement predestine them for use on highly-dynamic conventional axes as well as on direct drives.

	Accuracy grade	Signal period	Measuring length	Interface	Model
<b>Linear encoders with slimline scale housing</b>					
<b>Absolute</b>	± 5 µm; ± 3 µm	–	to 2040 mm <sup>1)</sup>	EnDat 2.2	<b>LC 483</b>
<b>Incremental</b>	± 5 µm; ± 3 µm	4 µm	to 1220 mm	~ 1 V <sub>PP</sub>	<b>LF 481</b>
	± 5 µm; ± 3 µm	20 µm	to 2040 mm <sup>1)</sup>	~ 1 V <sub>PP</sub>	<b>LS 487</b>
<b>Linear encoders with full-size scale housing</b>					
<b>Absolute</b>	± 5 µm; ± 3 µm	–	to 4240 mm	EnDat 2.2	<b>LC 183</b>
<b>Incremental</b>	± 3 µm; ± 2 µm	4 µm	to 3040 mm	~ 1 V <sub>PP</sub>	<b>LF 183</b>
	± 5 µm; ± 3 µm	20 µm	to 3040 mm	~ 1 V <sub>PP</sub>	<b>LS 187</b>
	± 5 µm	40 µm	to 30040 mm	~ 1 V <sub>PP</sub>	<b>LB 382</b>

<sup>1)</sup> Over 1240 mm measuring length only with mounting spar



**LC 483**



**LC 183**



**LB 382**

## HEIDENHAIN

**DR. JOHANNES HEIDENHAIN GmbH**

Dr.-Johannes-Heidenhain-Straße 5

**83301 Traunreut, Germany**

☎ +49 (8669) 31-0

FAX +49 (8669) 5061

E-Mail: info@heidenhain.de

[www.heidenhain.de](http://www.heidenhain.de)

### For more information:

- *Linear Encoders for Numerically Controlled Machine Tools* catalog
- *Accuracy of Feed Axes* Technical Information

